

Work Order ID 154581

Thursday, December 15, 2016 11:36:08 AM

154581

Page 1

Item ID: D209-669-043

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH

Start Date: 12/19/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 1/5/2017 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

VS

Date:

11/2/15

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D2906

Rev B (DEO)

100

Document Control

0.00

100

DOCUMENT CONTROL

DC

Memo

0.00

Doc.Control -USB or Paperwork

Photocopy D209-669 bluefile & type labels per PPP D205-669-043 Chg 003

110

Skidtubes

0.00

110

Skidtubes

Memo

0.00

Skidtubes

- Inspect mat'l D2500-1-190 for damage

-Drill pilot holes using drill jig DT8149, DT8711-1 & DT8711-3 (Do not use cutting fluid)

-Open holes to 0.500" as per Dwg D2906

-Deburr and blow out all chips from inside of tube. Test fit DT9916 on fwd and aft saddles.

-Acid etch and Alodine tube per QSI 005 4.1

16-12-22 DT
VBE

17-01-04

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : _____							

Work Order ID 154581

Thursday, December 15, 2016 11:36:08 AM

154581

Page 2

Item ID: D209-669-043 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH
Start Date: 12/19/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 1/5/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

120

QC5- Inspect part completeness to step on W/O

0.00

120

QC

Memo

0.00

Quality Control

DAS
03
9-89

17-1-4

130

Skidtubes

0.00

130

Skidtubes

Memo

0.00

Skidtubes

-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting
Pick:

Qty Part Number Description Batch

A/R Sikaflex-291

Sikaflex expire date: 17-02-16

Start Time:

Date:

Fin Time:

Date:

136093

16:00

17-01-09

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER :							
Misidentified ☐	Past Due ☐								

Work Order ID 154581

Thursday, December 15, 2016 11:36:08 AM

154581

Page 3

Item ID: D209-669-043 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH
Start Date: 12/19/2016 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 1/5/2017 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140		0.00							
140	BENDING MACHINE - CROSSTUBES								
CNC Bend 1	Memo	0.00							
CNC Delta 100 Bender	1-Bend as per program COB43FWD & COBRAFT on CNC Bender and Folio FT7&8								
	2-Cut tubes as per Dwg. D2906								
150		0.00							
150	Skidtubes								
Skidtubes	Memo	0.00							
Skidtubes	-Deburr ends and remove marks from bending								
	- Insert D4202-1 spacer, swage as per QSI002 and trim/ grind flush per QSI002 and dwg. Hold x-bolt with DT9701 Use tube expander 1/2 x17G to start expansion and finish with 1/2 x 18G to achieve dwg dimention.								
160		0.00							
160	QC5- Inspect part completeness to step on W/O								
QC	Memo	0.00							
Quality Control									

Handwritten notes: DP 12-1-9, DTG

DQA:

Date: 2017-02-16



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed:

Date: JAN 26 2017

Work Order update only ☐

Work Order: 154581		DISPOSITION		AGAINST DEPARTMENT/PROCESS					
Part No. D209-669-043		Rework ☐		Skid-tube ☒	Cross tube ☐	Water Jet ☐	Engineering ☐		
NCR No. 17-6239		Scrap ☒		Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐		
		Use-as-is ☐		Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐		
		Suspected Unapproved ☐		Large Fab ☐	Composite ☐	Supplier ☐			
Date: 17-1-9		Step #: 140		QTY Effective: 1			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition			Completed By		
Aft Bend Tangent 1" Start, Tube Bent at wrong location. P.A. - Re-adjust Bend Program.				Scrap Tube, NO Replace.			5 17/01/17		
							Lead hand / Supervisor Approval Verification		
							QC / QA Coordinator Approval		
Root Cause				FAULT CATEGORY					
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☒	Bending ☒	Set-up ☐	Folio/Program ☒	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	☒ Manufacturing Process								
Misidentified ☐	Past Due ☐	OTHER :							

Work Order ID 154581

Thursday, December 15, 2016 11:36:08 AM

154581

Page 4

Item ID: D209-669-043

Accept

N9000401 00

Setup Start *NS1*

Revision ID:

Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH

Stop ***NS2***

Start Date: 12/19/2016 **Start Qty:** 1.00 ***1***

Cust Item ID:

Required Date: 1/5/2017 **Req'd Qty:** 1.00 ***1***

Customer:

Reference:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

170

0.00

170

Large Fab

0.00

Skidtubes

Skidtubes

Memo

-Drill holes for wearplates using DT8217 Open holes to 19/64", adjust stopper not to hit web.Deburr

-Drill pilot holes for aft & fwd cap using DT8215 open holes to #6" Deburr

-Drill pilot holes for Tow ring using DT9555 , open to .640"and Deburr

190

QC5- Inspect part completeness to step on W/O

0.00

190

0.00

QC

Memo

Quality Control

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QS1042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER :					

Thursday, December 15, 2016 11:36:08 AM

154581

Item ID: D209-669-043

Accept

N900040100

Setup Start *NS1*

Stop ***NS2***

Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH

Start Date: 12/19/2016 **Start Qty:** 1.00 ***1***

Cust Item ID:

Required Date: 1/5/2017 **Req'd Qty:** 1.00 ***1***

Customer:

Reference:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

[illegible]

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐		FAULT CATEGORY		Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
		OTHER : _____							

Work Order ID 154581

Thursday, December 15, 2016 11:36:08 AM

154581

Page 6

Item ID: D209-669-043**Accept*****N900040100*****Setup Start*****NS1*****Revision ID:****Stop*****NS2*****Item Name:** AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH**Start Date:** 12/19/2016 **Start Qty:** 1.00***1*****Cust Item ID:****Required Date:** 1/5/2017 **Req'd Qty:** 1.00***1*****Customer:****Reference:****Approvals:****Process Plan:** _____**Date:** _____**Tooling:** _____**Date:** _____**Run Start*****NR1*****QC:** _____**Date:** _____**SPC (Y/N):** _____**Date:** _____**Stop*****NR2*****Sequence ID/
Work Center ID****Operation
Description****Set Up/
Run Hours****Tool ID****Tool #****Plan
Code****Accept
Qty****Reject
Qty****Reject
Number****Insp.
Stamp**

230

0.00

230

HandFinishing

0.00

HandFinish

Hand Finishing

Memo

1-Install inserts & wearplates as per Dwg. D2906. Use a drop of Sikaflex on insert holes before installing wearplates

A/R Sikaflex-291 _____

Sikaflex expire date: _____

2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2906

3-Inspect for foreign object per QSI 024

4-Install D2855 Fwd & Aft Cap as per Dwg D2906 and seal Fwd & Aft Cap with Sikaflex. Clean excess adhesive

A/R Sikaflex-291 _____

Sikaflex expire date: _____

5-Wing Walk as per Dwg D2906 and QSI 005 4.4

Batch: _____

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval 	
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	

Root Cause			FAULT CATEGORY							
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence
Past Expiry Date	☐	Manufacturing Process	☐	OTHER :						
Misidentified	☐	Past Due	☐							

Work Order ID 154581

Thursday, December 15, 2016 11:36:08 AM

154581

Page 7

Item ID: D209-669-043**Accept*****N900040100*****Setup Start *NS1*****Revision ID:****Stop *NS2*****Item Name:** AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH**Start Date:** 12/19/2016 **Start Qty:** 1.00 ***1*****Cust Item ID:****Required Date:** 1/5/2017 **Req'd Qty:** 1.00 ***1*****Customer:****Reference:****Approvals:** **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____**Run Start *NR1*****QC:** _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____**Stop *NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
240	QC5- Inspect part completeness to step on W/O	0.00							
240									
QC	Memo	0.00							
Quality Control	Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024								
250		0.00							
250	Packaging								
Packaging	Memo	0.00							
Packaging	Identify and pack for shipping as per PPPD209-669-043 Location: _____ PPP Rev: _____								
260	QC21- Final Inspection - Work Order Release	0.00							
260									
QC	Memo	0.00							
Quality Control									



JAN 17 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

Picklist Print

Thursday, December 15, 2016 11:36:13 AM

Page 1

Work Order ID: 154581

154581

Parent Item: D209-669-043

D209-669-043

Parent Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH

Start Date: 12/19/2016

Required Date: 1/5/2017

Start Qty: 1.00

Required Qty: 1.00

Comments: new IPP 08.02.13 LL, verified by: DD
IPP Rev:B remove DT # in seq140 DD 10.03.10 Verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D4202-1

Manufactured

No

Each

352.0000

19

D4202-1

Spacer

Location

Loc Qty

Loc Code

LG001

352

147952

3

151107

349

D2500-1-190

Manufactured

No

110

Each

91.0000

1

1

D2500-1-190

Ext'n - 'I' Beam Tube 4"

Location

Loc Qty

Loc Code

HALL

91

145247

11

151612

80

D2926-3

Manufactured

No

110

Each

0.0000

1

1

D2926-3

Web

D2855

Manufactured

No

230

Each

93.0000

2

2

D2855

Cap

Location

Loc Qty

Loc Code

FP001

93

137568

1

147805

92

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
				Completed By 					
				Lead hand / Supervisor Approval Verification 					
				QC / QA Coordinator Approval 					

Root Cause			FAULT CATEGORY							
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence
Past Expiry Date	☐	Manufacturing Process	☐	OTHER : _____						
Misidentified	☐	Past Due	☐							

Picklist Print

Thursday, December 15, 2016 11:36:14 AM

Page 2

Work Order ID: 154581

154581

Parent Item: D209-669-043

D209-669-043

Parent Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH

Start Date: 12/19/2016

Required Date: 1/5/2017

Start Qty: 1.00

Required Qty: 1.00

AN3-5A	Purchased	No	230	Each	483.0000	4	4
--------	-----------	----	-----	------	----------	---	---

AN3-5A

Bolt

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
FP001	155	
m134502	155	
over003	300	
m136182	300	
ST350	28	
m135058	28	

NAS1149D0332J	Purchased	No	230	Each	1,619.000	4	4
---------------	-----------	----	-----	------	-----------	---	---

NAS1149D0332.J

Washer

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
FP001	100	
m134848	100	
GA	146	
m134848	146	
ST260a	1200	
m136015	1200	
ST264	173	
m135672	173	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval Completed By _____ Lead hand / Supervisor Approval Verification _____ QC / QA Coordinator Approval _____		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Picklist Print

Thursday, December 15, 2016 11:36:14 AM

Page 3

Work Order ID: 154581

154581

Parent Item: D209-669-043

D209-669-043

Parent Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH

Start Date: 12/19/2016

Required Date: 1/5/2017

Start Qty: 1.00

Required Qty: 1.00

ALS7-1032-130

AELS8-1032-130 Purchased

No

230

Each

605.0000

44

44

AI S7-1032-130

Rivnut

Location

Loc Qty

Loc Code

FG

100

M128649

50

M136048

50

FP001

155

M128649

155

ST556

350

M136048

350

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : _____							

Picklist Print

Thursday, December 15, 2016 11:36:14 AM

Page 4

Work Order ID: 154581

154581

Parent Item: D209-669-043

D209-669-043

Parent Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH

Start Date: 12/19/2016

Required Date: 1/5/2017

Start Qty: 1.00

Required Qty: 1.00

AN3C4A

Purchased

No

230

Each

1,776.000

44

44

AN3C4A

Bolt

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
FG	20	
122814	20	
FP001	1556	
M133440	7	
M134396	41	
M134509	6	
M134606	29	
M134676	44	
M134762	106	
M134861	13	
M135058	123	
M135127	22	
M135297	52	
M135442	2	
M135774	53	
M135864	64	
M135948	17	
M136295	977	
ST350	200	
M135704	200	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER :							
Misidentified ☐	Past Due ☐								

Picklist Print

Thursday, December 15, 2016 11:36:14 AM

Page 5

Work Order ID: 154581

154581

Parent Item: D209-669-043

D209-669-043

Parent Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH

Start Date: 12/19/2016

Required Date: 1/5/2017

Start Qty: 1.00

Required Qty: 1.00

NAS1149C0332R

Purchased

No

230

Each

4,427.000

44

44

NAS1149C0332R

WASHER

Location

Loc Qty

Loc Code

FP001

2059

m135672

33

m135948

14

m136199

12

m136301

2000

GA

74

m133284

74

ST260a

1500

m135466

1000

m136042

500

ST266

794

m135408

94

m135766

500

m135908

200

D2594-3

Manufactured

No

230

Each

858.0000

14

14

D2594-3

O-Ring

Location

Loc Qty

Loc Code

FP001

858

135859

24

138060

2

140770

2

145268

323

147875

7

153944

500

Thursday, December 15, 2016 11:36:14 AM

Shop Packet Print

Page 5

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
							Completed By		
							Lead hand / Supervisor Approval Verification		
							QC / QA Coordinator Approval		

Root Cause				FAULT CATEGORY			
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐
Design	☐	Operator	☐	Bending	☐	Set-up	☐
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐
Past Expiry Date	☐	Manufacturing Process	☐	OTHER : _____ _____ _____			
Misidentified	☐	Past Due	☐				

Picklist Print

Thursday, December 15, 2016 11:36:14 AM

Page 6

Work Order ID: 154581

154581

Parent Item: D209-669-043

D209-669-043

Parent Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH

Start Date: 12/19/2016

Required Date: 1/5/2017

Start Qty: 1.00

Required Qty: 1.00

D2594-1 Manufactured No 230 Each 324.0000 14 14

D2594-1

Plug

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
FP001	324	
119830	68	
134804	16	
147564	1	
147974	7	
148319	97	
150991	100	
151587	3	
42807	25	
88922	7	

D3564-9 Manufactured No 230 Each 15.0000 1 1

D3564-9

Wearplate Fwd

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
FG	6	
76950	4	
88407	2	
FP002	9	
151145	9	

D3564-11 Manufactured No 230 Each 12.0000 1 1

D3564-11

Wearplate Aft

<u>Location</u>	<u>Loc Qty</u>	<u>Loc Code</u>
FG	4	
77056	4	
FP002	8	
152217	8	

Thursday, December 15, 2016 11:36:14 AM

Shop Packet Print

Page 6

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval				
Description Work Order Deviation				Disposition							
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		☐ Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter		FAULT CATEGORY		☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes		☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center		☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence	
		OTHER : _____									

Picklist Print

Thursday, December 15, 2016 11:36:14 AM

Page 7

Work Order ID: 154581

154581

Parent Item: D209-669-043

D209-669-043

Parent Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH

Start Date: 12/19/2016

Required Date: 1/5/2017

Start Qty: 1.00

Required Qty: 1.00

D3564-5

Manufactured No

230

Each

10.0000

1

1

D3564-5

Wearplate Center

Location

Loc Qty

Loc Code

FG

3

34806

1

89048

2

FP002

7

151722

1

152930

6

D3566-1

Manufactured No

230

Each

47.0000

2

2

D3566-1

Gasket Aft / Fwd

Location

Loc Qty

Loc Code

FG

11

117012

4

139221

4

151632

3

FP001

36

139221

4

140819

1

151476

1

151632

4

154120

6

154311

20

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
							Completed By		
							Lead hand / Supervisor Approval Verification		
							QC / QA Coordinator Approval		

Root Cause				FAULT CATEGORY			
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐		
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐		
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐		
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐		
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐		
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐		
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐		
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐		
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐		
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐		
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____					
Misidentified ☐	Past Due ☐						

Picklist Print

Thursday, December 15, 2016 11:36:14 AM

Page 8

Work Order ID: 154581

154581

Parent Item: D209-669-043

D209-669-043

Parent Item Name: AH-1F/P/S Replacement Skidtube with Standard Wearplates, Fits LH or RH

Start Date: 12/19/2016

Required Date: 1/5/2017

Start Qty: 1.00

Required Qty: 1.00

D3566-5

Manufactured No

230

Each

34.0000

1

1

D3566-5

Gasket Center Aft

Location

Loc Qty

Loc Code

FG

4

139236

2

148071

2

FP001

30

147914

5

153361

25

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By _____ Lead hand / Supervisor Approval Verification _____ QC / QA Coordinator Approval _____		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		OTHER : _____					



QTY -041	QTY -043	Part Number	Description
X		D2906-041	SKIDTUBE ASSEMBLY
	X	D2906-043	SKIDTUBE ASSEMBLY
1	1	D2500-1-190	EXTRUSION
22	19	D2579	CROSS BOLT SPACER
12	14	D2594-1	PLUG
12	14	D2594-3	O-RING
2	2	D2855	AFT CAP
1		D2926-1	WEB
	1	D2926-3	WEB
1	1	D3564-9	WEARSHOE (REPLACES D2577-1)
1	1	D3564-11	WEARSHOE (REPLACES D2577-3)
1	1	D3564-5	WEARSHOE (REPLACES D2577-5)
1		D3564-15	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
1		D3566-15	GASKET
50	44	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or ALS4-1032-130	INSERT
50	44	AN3C4A	BOLT
4	4	AN3-5A	BOLT
50	44	AN960C10L	WASHER
4	4	AN960JD10L	WASHER

GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 2) LENGTH OF D2500-1 EXTRUSION BEFORE BENDING = 190 INCHES.
- 3) INSERT D2926-1/-3 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241/291 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 6) USE DART DRILL TEMPLATE DT2906-041T1 (D2906-041) OR DT2906-043T1 (D2906-043) TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION C-C AFTER FINISH. INSTALL AN3C4A BOLTS AND AN960C10L WASHERS WITH SIKAFLEX-241/291.
- 7) WELDING TO BE DONE PER DART QSI 004.
- 8) FINISH:
ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2926-1/-3 WEB. POWDER COAT ASSEMBLY WHITE (REF 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4
- 9) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (12 PLACES).
- 10) ALL DIMENSIONS ARE IN INCHES.

SHOP COPY

RETURN TO
ENGINEERING

UNCONTROLLED COPY
SUBJECT TO AMENDMENT

WITHOUT NOTICE
WORK ORDER

NO. 15481


16/12/15

RELEASED


07.09.04

B	UPDATE DRAWING FORMAT; RE-ORGANIZE; ADD STAINLESS STEEL WEARPLATES AND GASKETS CHANGE WEARPLATE HARDWARE TO SS; PG 1: ADD NOTE 10; PG 2 C7: REMOVE AFT Ø0.640 HOLE FROM -041; PG 3 C3: CORRECTED -043 CAP P/N; PG 3 D7: 38 PLACES WAS 44 PLACES;	CB	07.08.21
A	NEW ISSUE	CP	04.06.22
REV.	DESCRIPTION	BY	DATE
DESIGN	90	DART AEROSPACE LTD	
DRAWN	CB	HAWKESBURY, ONTARIO, CANADA	
CHECKED	PH	DRAWING NO.	REV. B
MFG. APPR.	21	D2906	SHEET 1 OF 3
APPROVED	21	TITLE	SCALE
DE APPR.	21	AH-1 (209) SKIDTUBE ASSEMBLY	NTS
DATE	07.08.21	COPYRIGHT © 2004 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	


8 7 6 5 4 3 2 1

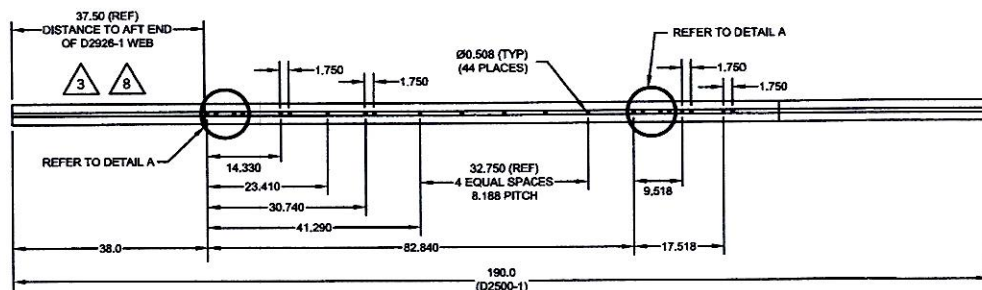


D2906-1 DRILLING DETAIL

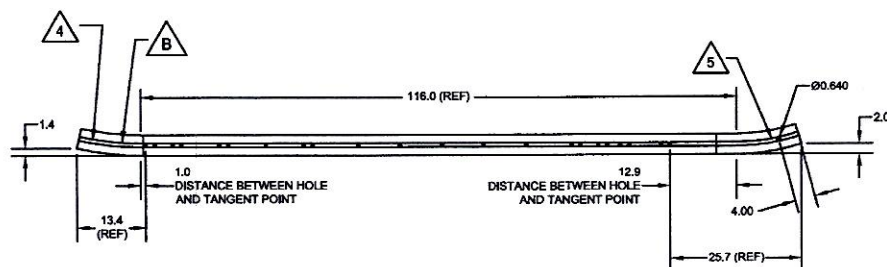


D2906-041 BENDING AND CUTTING DETAIL

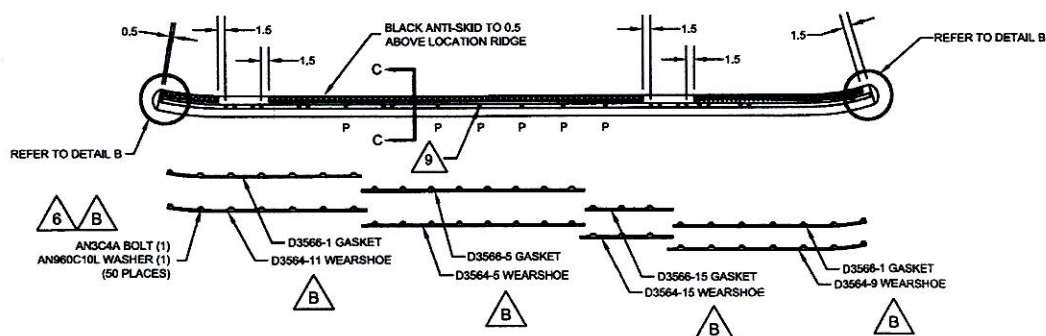

D2906-041 ASSEMBLY DETAIL

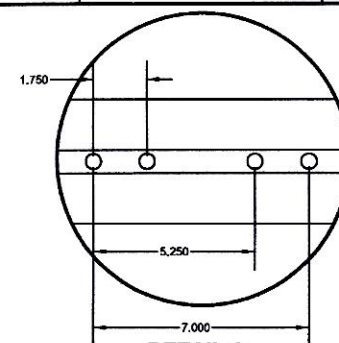


DETAIL A
SCALE 1:4

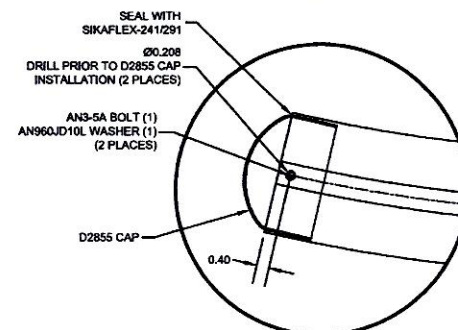

DETAIL B
SCALE 1:4

RELEASED
07.09.04

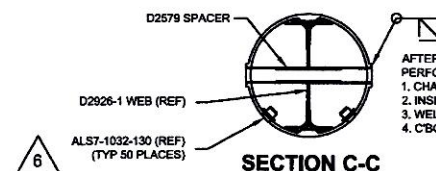


SECTION C-C
SCALE 1:4


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (22 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C-BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP

DESIGN	90	DART AEROSPACE LTD	
DRAWN	C.B.	HAWKESBURY, ONTARIO, CANADA	
CHECKED	PH	DRAWING NO.	REV. B
MFG. APPR.	PH	D2906	SHEET 2 OF 3
APPROVED	PH	TITLE	SCALE
DE APPR.	PH	AH-1 (209) SKIDTUBE ASSEMBLY	1:24
DATE	07.08.21	COPYRIGHT © 2004 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD			


8 7 6 5 4 3 2 1

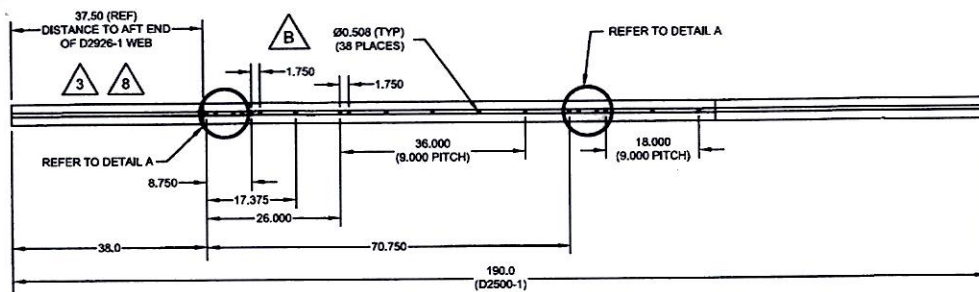


D2906-3 DRILLING DETAIL

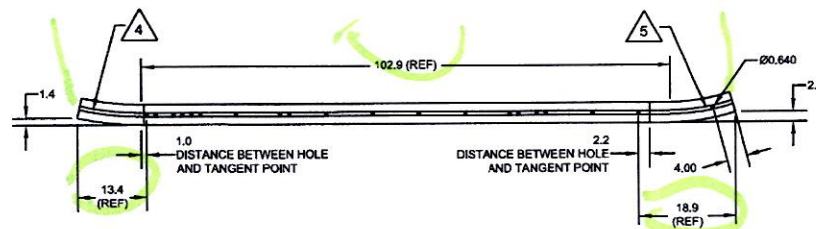


D2906-043 BENDING AND CUTTING DETAIL

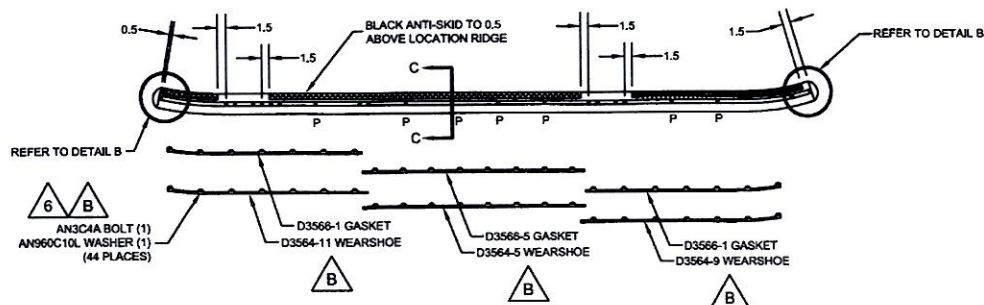

D2906-043 ASSEMBLY DETAIL

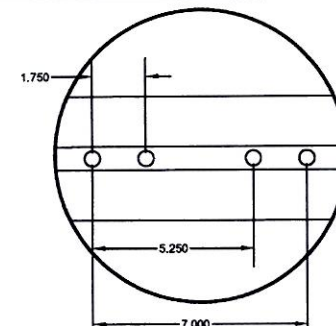


**DETAIL A
SCALE 1:4**

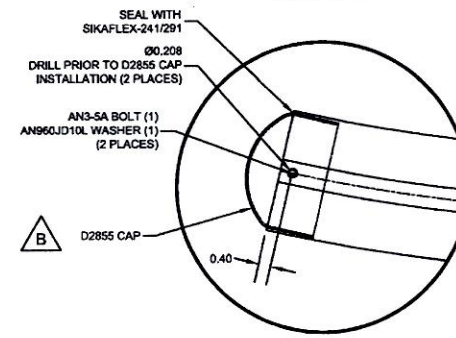

**DETAIL B
SCALE 1:4**

RELEASED

07.09.04

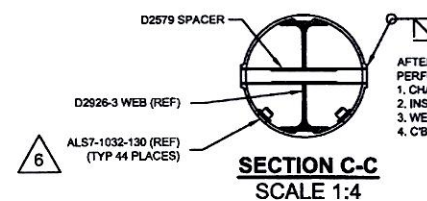

**SECTION C-C
SCALE 1:4**

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (22 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C-BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP

DESIGN	<i>P</i>	DART AEROSPACE LTD	
DRAWN	<i>C.B.</i>	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>PH</i>	DRAWING NO.	REV. B
MFG. APPR.	<i>PH</i>	D2906	SHEET 3 OF 3
APPROVED	<i>PH</i>	TITLE	SCALE
DE APPR.	<i>PH</i>	AH-1 (209) SKIDTUBE ASSEMBLY	1:24
DATE	07.08.21	COPYRIGHT © 2004 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

DRAWING NO. D2906	TITLE AH-1 (209) SKIDTUBE ASSEMBLY	REV. B	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D2906-B-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN A.P.	CHECKED <i>[Signature]</i>	MFG. APPR. <i>[Signature]</i>	APPROVED <i>[Signature]</i>		DE APPR. <i>[Signature]</i>		
DATE 12.05.28	DATE 12.05.28	DATE 12.05.31	DATE 12.05.31		DATE 12.05.31		

PURPOSE:

CHANGE ALL C'BORED WELDED CROSSBOLT SPACERS TO SWAGED SPACERS

CHANGE:

PARTS LIST IS AMENDED AS FOLLOWS:

WAS


QTY	QTY	PART NUMBERS	DESCRIPTION
-041	-043		
22	19	D2579	CROSS BOLT SPACER

IS

22	19	D4202-1	SPACER
----	----	---------	--------

SECTION C-C ON SHEETS 2 & 3 ARE AMENDED AS FOLLOWS FOR ALL HOLES THAT WERE ORIGINALLY C'BORED:

RELEASED
2012-06-05
[Signature]

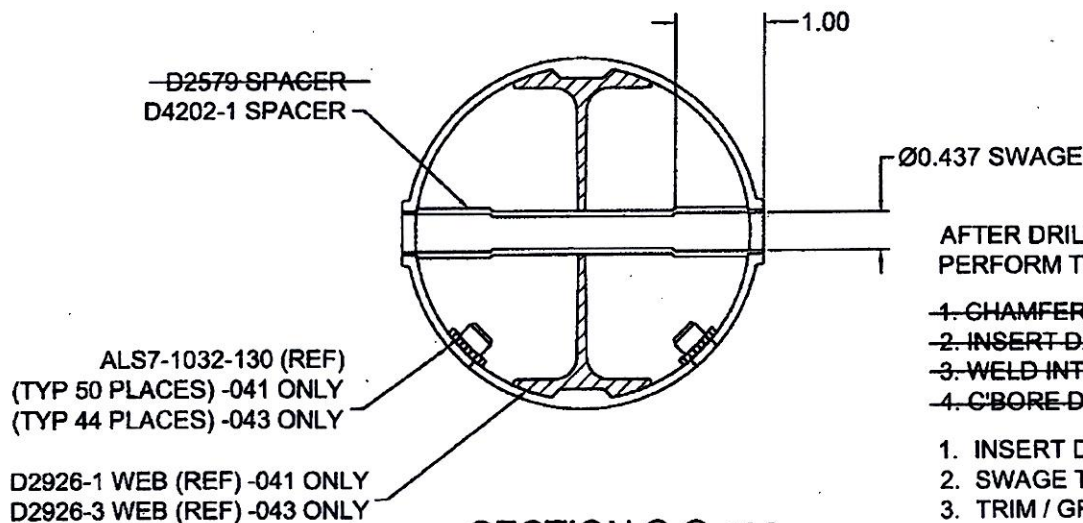

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:

- ~~1. CHAMFER HOLE 0.050 X 45°~~
- ~~2. INSERT D2579 SPACER (20 PLACES)~~
- ~~3. WELD INTO PLACE AND GRIND FLUSH~~
- ~~4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP~~

1. INSERT D4202-1 SPACER, 22 PL (-041) OR 19 PL (-043)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM / GRIND FLUSH PER QSI 002

SECTION C-C A2-2
NOT TO SCALE A2-3